

SERVICE BULLETIN NO. 9

1999 Ford F250 - F350 SuperDuty STEERING (PITMAN ARM) INTERFERENCE


Mounting Carton 81019

Reports from the field have indicated Interference between the steering linkage (Pitman Arm) and the Driver's side Push Arm (80291) on the Ford F250 and F350 4x4 SuperDuty vehicles.

Vehicles manufactured after March 15, 1999

Ford Motor Company has incorporated changes in the Steering Damper area. The steering pitman arm has been lengthened by 1.0 inch. This causes a severe interference problem when turning the steering wheel to the left. To correct the problem, Driver's side Push Arm (80291) has been re-engineered. The new Push Arm (80386) is now available. This new Push arm is only necessary on vehicles manufactured after March 15, 1999. Driver's side Push Arm (80291) will fit fine on vehicles manufactured prior to March 15, 1999.

Diamond Equipment recommends that all mountings installed on vehicles manufactured after March 15, 1999 be inspected for possible interference.

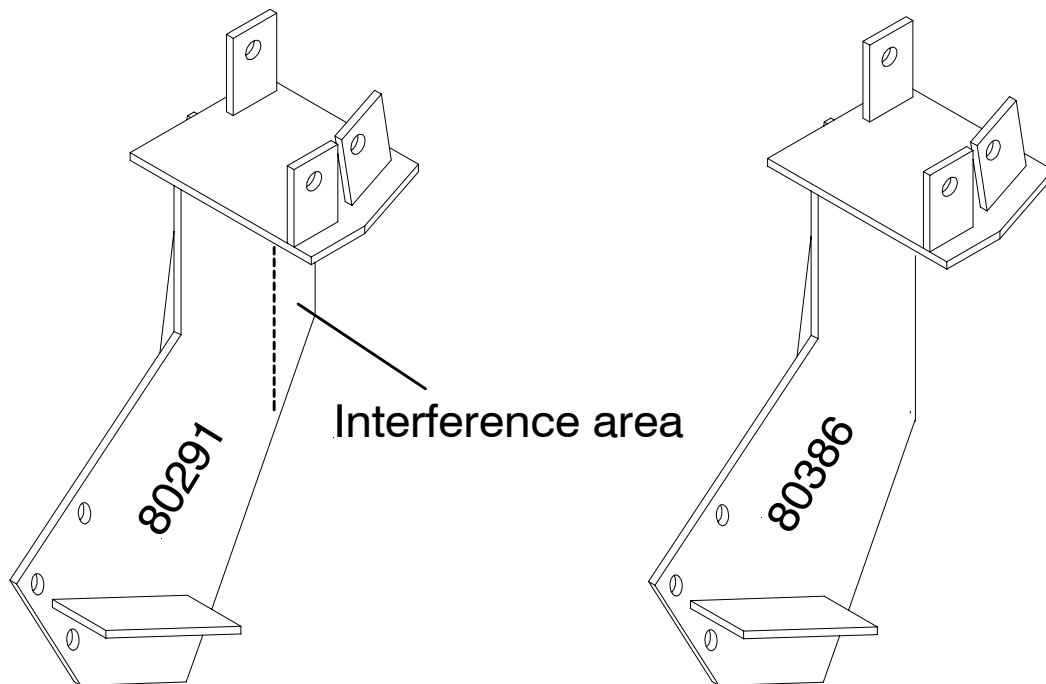

When ordering Update Kits, please Contact the Sales Department.

Diamond Equipment assumes no responsibility for installations not made according to these instructions. Diamond Equipment reserves the right, under its continuing product improvement program, to change construction or design details, specifications and prices without notice or without incurring any obligation.