



SNOWPLOWS

by Meyer

SERVICE BULLETIN NO. 26

81018, 81023 and 17120 Mountings


2001 & Later Chevrolet C/K 2500/3500

General Motors has made a frame change late in 2001 affecting our mounting installations on 2001 & Later 2500 and 3500 C/K trucks. GM has relocated a hole on the bottom side of the frame for the passenger side Tow Hook.

This change will affect the 81018, 81023 E-Z Mount and the 17120 MDII Mount. This change will require the slotting of one hole in our 80339 Clevis (81018 mount), 80373 Clevis (81023) and the 11812 RH Side Mount (17120). See illustrations below.


Under Diamond Equipments continued product improvement program our Engineers will be redesigning the affected parts.

Hole will need to be slotted 1/4" to the rear of vehicle

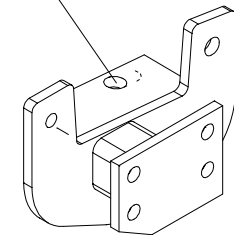


17120 MDII Mount
Part No. 11812 RH Side Mount

Hole will need to be slotted 1/4" to the rear of vehicle

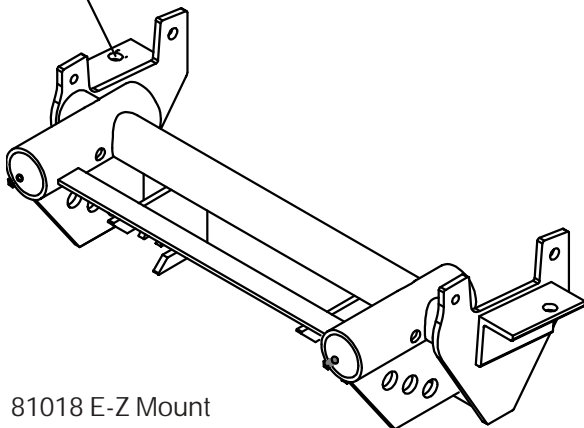

81018 E-Z Mount
Part No. 80339 Clevis

Hole will need to be slotted 1/4" to the rear of vehicle

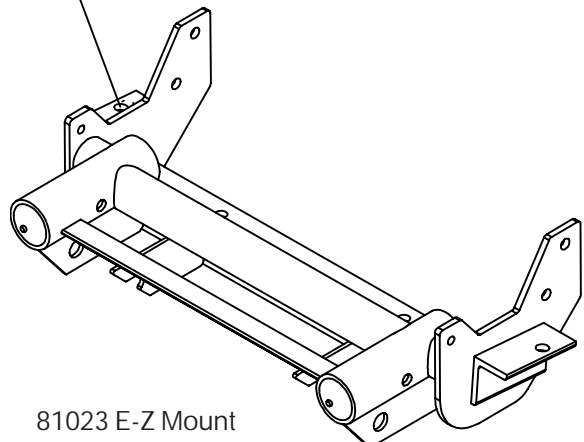

81023 E-Z Mount
Part No. 80373 Clevis

Diamond Equipment assumes no responsibility for installations not made in accordance to these instructions.

Meyer Products andDiamond Equipment reserves the right, under its continuing product improvement program, to change construction or design details, specifications and prices without notice or without incurring any obligation.

