

# NOTICE

## Blizzard Power Plow - Model 810

Issued December 3, 1999

The manifold assembly has ten DIN connectors that attach to each of the red DIN solenoids. Depending on the model vehicle you are installing your Power Plow on, the DIN connectors can interfere with the bumper of the vehicle. When the snowplow is in the raised position, the two top solenoids ("S9" and "S1" indicated in the stamping on the block) make contact with the bumper. This action, or the forceful impact of the plow into a snow bank in the raised position can damage a solenoid. Take corrective measures by installing **ALL** DIN connectors as illustrated below or increase the tension on the torsion bar on the vehicle and lower the push beam height (recommended push beam height is 12-1/2").

Notice the two DIN connectors and respective solenoids have been rotated such that they face down and outward. Also, if the DIN connectors are positioned wrong, they can interfere with the pump and manifold cover.

Should you have questions regarding proper installation, contact our Customer Service Department at 1-888-680-8600.

